

## INSPECTION REPORT PART (IRP)

<b>INSPECTION NO FOR CLIENT REFERENCE:</b>	COFAN
<b>PRODUCT NAME / ITEM NUMBER:</b>	TROUSER (1100208)
<b>COLOR</b>	DARK BLUE
<b>PO NUMBER:</b>	N/A
<b>ORDER QUANTITY</b>	2560 PCS
<b>CHECKED QUANTITY</b>	125 PCS
<b>INSPECTION DATE:</b>	12/02/2024
<b>FACTORY DETAILS:</b>	VINIT GLOVES

### INSPECTION STANDARDS

<b>Inspection type</b>	Final Inspection before Shipment
<b>Inspection Level</b>	II
<b>Sampling plan</b>	Single


### INSPECTION SUMMERY

<b>5 : WORKMANSHIP</b>	<b>ACTUAL FINDINGS</b>	<b>AQL</b>	<b>CRI</b>	<b>MAJ</b>	<b>MIN</b>
		<b>Findings</b>	<b>0</b>	<b>8</b>	<b>0</b>
		<b>ALLOWED</b>	<b>0</b>	<b>7</b>	<b>10</b>
		<b>Checked sample</b>	<b>125</b>		

## REMARKS FROM THE INSPECTOR

1. **FACTORY PROVIDED 100% (2560 PCS) IN 256 CARTONS FOR CHECKING**
2. **NO CLIENT APPROVED SAMPLE PROVIDED BY THE FACTORY EXCEPT THE TECHNICAL SHEET AND TRIM DETAILS.**
3. **AS PER THE TECHNICAL PACKAGE THERE SHOULD BE A BARTACK ON THE FLY OF ZIPPER WHICH IS FOUND MISSING IN BULK PRODUCT, FACTORY NEED TO VARRIFY BEFORE FINAL SHIPPING.**
4. **DIMENSION OF THE PRODUCT IS FOUND SATISFACTORY AGAINST THE FACTORY PROVIDED SPEC SHEET EXCEPT #HALF THIGH (10 CM FROM) IS NOT UPTO THE MARK AGAINST THE TECHNICAL PACKAGE, FACTORY NEEDS TO BE RE-CONFIRMING THE POINT BEFORE SHIP.**

5. ALL BARCODE, PACKET & PACKAGING IS FOUND SATISFACTORY AGAINST THE PROVIDED DOCUMENTS BY SUPPLIER.
6. AFTER ALTERATION MAKING ALL PCS SHOULD BE WELL TRIMED (DOUBLE THREAD AND LOOSE THREAD SHOULD NOT BE VISIBLE ESPECIALLY IN FRONT AREA) WHICH IS FOUND IN LOT OF PCS.
7. BELOW DESCRIBED ALL DEFECTS ARE MAJOR DEFECTS.

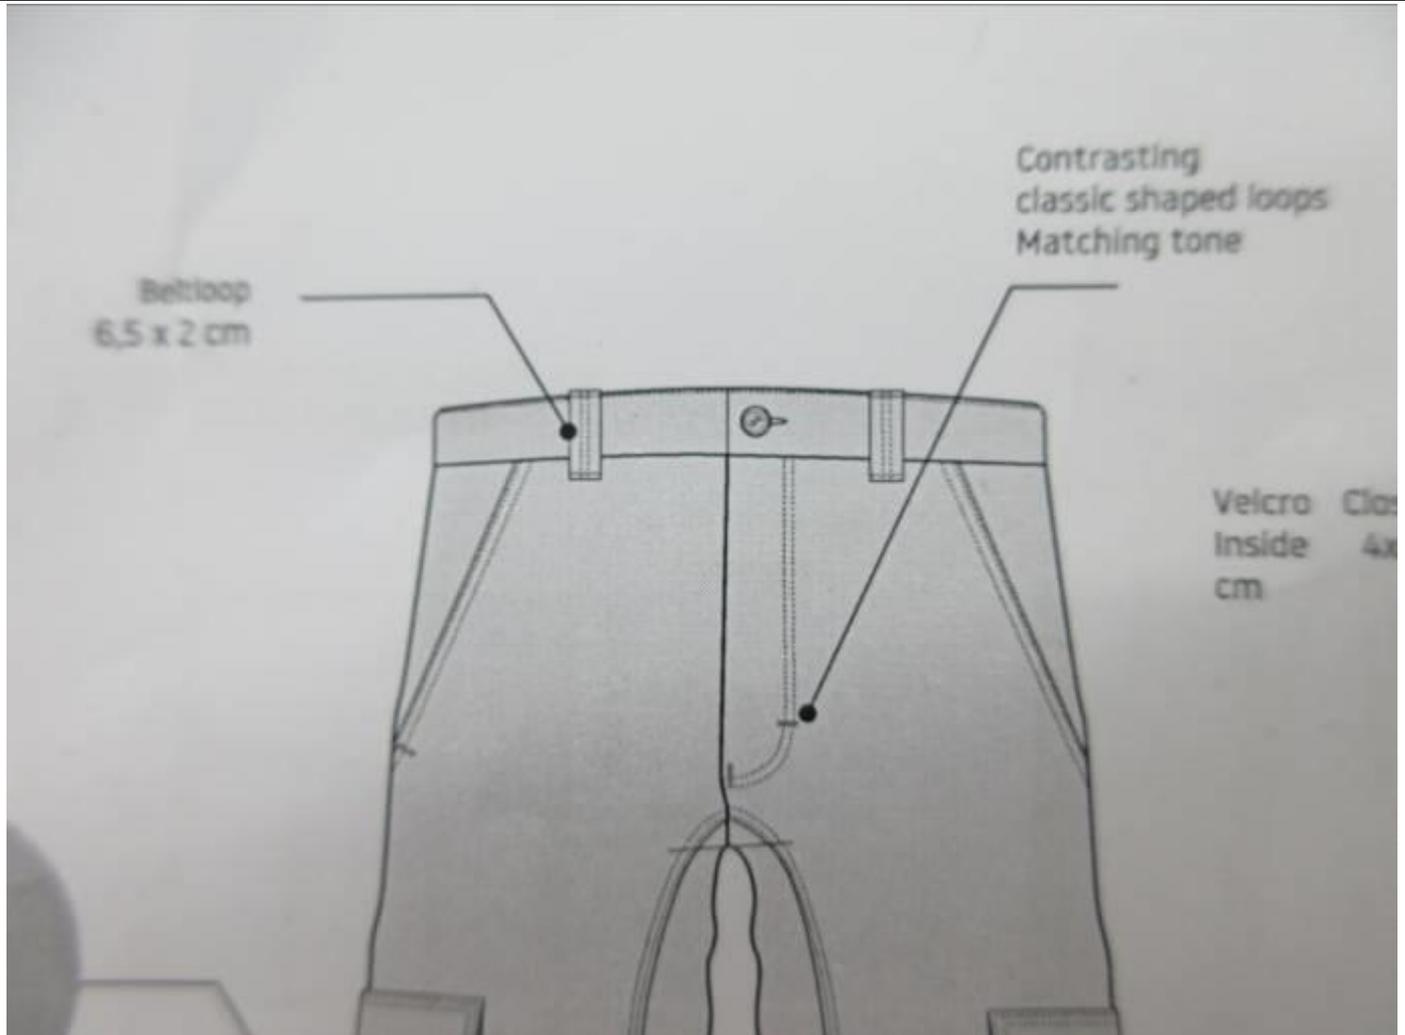

**TECHNICAL PACKAGE AGAINST REMARK NO. 3**

COFAN TROUSER																												Date: 12/02/24
ARTICLE NO. 11002008														COLOUR: NAVY BLUE														
PARTICULARS	38	38	40	40	42	42	44	44	46	46	48	48	50	50	52	52	54	54	56	56	58	58	60	60	62	62	64	TOLERANCE
1/2 WAIST RELAX	32	✓	34	✓	36	+1	38	+5	40	✓	42	+5	44	✓	46	✓	48	+5	50	✓	51	+5	52	+1	54	✓	56	+5
1/2 WAIST STRETCHED	42	✓	44	+5	46	+5	48	✓	50	+1	52	+5	54	✓	56	✓	58	✓	60	+5	61	✓	62	✓	64	✓	66	+5
1/2 HIP	54	+5	55	✓	57	+5	59	✓	60	✓	62	✓	64	+1	66	+5	67	✓	69	✓	70	+5	72	-5	74	-5	77	-5
FRONT RISE (INCLUDING WAIST)	28	✓	28	-5	29	✓	29	-5	30	✓	30	✓	31	✓	31	✓	32	-5	32	✓	33	✓	33	✓	34	✓	34	✓
BACK RISE (INCLUDING WAIST)	41	✓	41	✓	42	-5	42	✓	43	+5	43	-5	44	+5	44	✓	45	✓	45	+1	47	✓	47	✓	48	+5	48	✓
1/2 THIGH (TO 10 CM FROM)	30	+5	31	+5	32	✓	33	+1	34	-5	35	✓	36	✓	37	+5	38	✓	39	-5	40	-5	41	+5	42	✓	43	+5
IN LEG	82	✓	82	✓	82	✓	82	✓	82	✓	82	-5	82	-5	82	✓	82	+5	83	-5	40	-5	41	+5	42	✓	43	+5
1/2 LEG BOTTOM	22	✓	22	✓	22	✓	22	✓	22	✓	22.5	✓	22.5	✓	23	✓	23	✓	23.5	✓	23.5	✓	23.5	+5	23.5	✓	24	+5

**MEASUREMENT DATA**

**Actual view of Product:**







NO PICTURE

## WORKMANSHIP/DEFECTIVES LIST

Actual Pictures of above described defect found:



**BARTACK MISSING**



**BARTACK MISSING**



**BARTACK MISSING**



**BARTACK MISSING**



**MISSING STITCH**



**BROKEN STITCH**



**INSECURE STITCH**



**INSECURE MARGIN(RAW EDGES)**

**End of the Report**

---